### 4000 COUNTS AUTO RANGE INTELLIGENT DIGITAL AC/DC CLAMP MULTIMETER OPERATION MANUAL


This LCD Auto Range Intelligent Digital AC/DC clamp multimeter is a portable, 4000 counts multimeter. It is ideally suited for field, laboratory, shop and home applications. The meter can be connected with mobile phone by Bluetooth, and display on phone by APP, you can remote monitoring the measurement condition, the distance control is  $10\sim15$ m.

# 1. SAFETY INFORMATION

The following safety information must be observed to insure maximum personal safety during the operation at this meter.

- 1) When measuring voltage ensure that instrument is not switched to the current range, resistance range, diode and continuity range, capacitance range or temperature range.
- 2) Use extreme care when measuring voltage above 50V. especially from sources where high energy is existed.
- 3) Avoid making connections to "live" circuits whenever possible.
- 4) Before making resistance measurements, diode or continuity test, capacitance test or temperature test, ensure that the circuit under test is de-energized.
- 5) Always ensure that the correct function and range is selected.
- 6) Extreme care should be taken when using the instrument to conjunction with a current transformer connected to the terminals if an open circuit occurs.
- 7) Ensure that the test leads and probes are in good condition with no damage to the insulation.
- 8) Take care not to exceed the over-load limits as given in the specifications.
- 9) Before opening the cover of the battery cabinet to replace batteries. disconnect the test leads from any external circuit, set the selector switch to "OFF" position.
- 10) Keep the fingers after the protection ring when measuring through the instrument lead.
- 11) Change the battery when the symbol "\begin{align\*} appears to avoid incorrect data.

#### 2. Panel Lavout

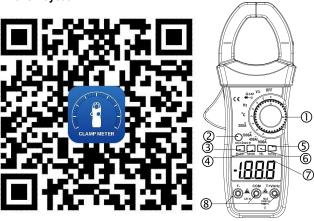

- 1) Rotary Switch: Use this switch to select functions and ranges.
- 2) D.HOLD/ Back Light key: In any range, push the key, the present display value will be locked and the "H" symbol will appear, push it again to exit. Press "D.HOLD" button more than 2 seconds, the back light will light, press it more than 2 seconds again, the back light will light off.
- 4) RANGE Key: Press the "RANGE" key, the meter enters manual range mode, press it more than 2 seconds again, return to auto mode.
- 5) Hz/Duty Key: On "ACV/ACA" or "Hz" range, press the "Hz/Duty" key, you can choose the Frequency or Duty Cycle measurement.
- 6) REL Key: Press the "REL" key, the meter enters relative measuring mode, "REL" is displayed on the LCD and the present reading becomes the reference value and displayed on the display. Relative measurement REL = measurement value-Reference value. Press it again to exit.
- 7) LCD display: 4000 counts digit, full function symbol display.
- 8) T+VΩ Input Jack、COM Input Jack、T- Input Jack

# 2. SPECIFICATIONS

# 2.1 GENERAL SPECIFICATIONS

Display: 4000 counts digit LCD with a max. reading of 4000.

Range control: Auto range control.

Polarity: Automatic negative polarity indication.

Zero adjustment: Automatic.

Over range indication: Only the "OL" display. Low Battery Indication: "=="" displayed

Safety Standards: The meter is up to the standards of IEC1010 Double

Insulation, Pollution Degree 2, Overvoltage Category II.

Clamp opening size: 45mm.

Operating Environment: Temperature  $0\sim40\,^{\circ}\text{C}$ , humidity <80%RH. Storage Environment: Temperature  $-20\sim60\,^{\circ}\text{C}$ , humidity <90%RH.

Power supply: 9V Zinc-carbon battery. Dimension: 225(H)×77(W)×45(D)mm. Weight: Approx. 330g (including batteries).

### 2.2 ELECTRICAL SPECIFICATIONS

Accuracies are ±(% of reading +number in last digit) at 23±5 °C,≤70%RH.

#### 2.2.1 DC Voltage

Range	Accuracy	Resolution
400mV	±(0.5% of rdg + 2 digits)	0.1mV
4V		1mV
40V		10mV
400V		100mV
1000V	±(0.8% of rdg + 2 digits)	1V

Overload protection: 1000V DC/750Vrms AC

Impedance:  $10M\Omega$ , More than  $100M\Omega$  on 400mV scale

#### 2.2.2 AC Voltage

Range	Accuracy	Resolution	Frequency
4V		1mV	
40V	$\pm (0.8\% \text{ of rdg} + 3 \text{ digits})$	10mV	40∼400Hz
400V		100mV	40°~400HZ
750V	±(1.2% of rdg + 3 digits)	1V	

Average sensing, calibrated to rms of sine wave Overload protection: 1000V DC/750Vrms AC

# Impedance: $10M\Omega$ . **2.2.3 DC Current**

ZiZio Do Garrent				
Range		Accuracy	Resolution	
200A		±(3.0% of rdg + 10 digits)	0.1A	
1000A	0∼800A	±(3.5% of rdg + 10 digits)	1A	
IUUUA	800∼1000A	$\pm (6.5\% \text{ of rda} + 10 \text{ digits})$	IA.	

Overload protection: 1000Arms within 60 seconds

#### 2.2.4 AC Current

Range		Range	Accuracy	Resolution	Frequency
	400A		$\pm (3.0\% \text{ of rdg} + 10 \text{ digits})$	0.1A	
	1000A	0∼800A	$\pm (3.5\% \text{ of rdg} + 10 \text{ digits})$	1A	50∼60Hz
	IUUUA	800∼1000A	$\pm$ (6.5% of rdg + 10 digits)	IA.	

Average sensing, calibrated to rms of sine wave Overload protection: 1000Arms within 60 seconds

#### 2.2.5 Resistance

Z.Z.3 Resistance				
Range	Accuracy	Resolution		
400Ω	±(1.0% of rdg + 3 digits)	0.1Ω		
4kΩ		1Ω		
40kΩ	$\pm (1.0\% \text{ of rdg} \pm 2 \text{ digits})$	10Ω		
400kΩ	±(1.0% of rdg + 2 digits)	100Ω		
4ΜΩ		1kΩ		
40ΜΩ	±(1.5% of rdg + 3 digits)	10kΩ		

Overload protection: 250V DC/250Vrms AC

#### 2.2.6 Capacitance

Z.Z.o Gapacitance			
Range	Accuracy	Resolution	
51.2nF	±(3.0% of rdg + 10 digits)	10PF	
512nF		100PF	
5.12µF	±(2.5% of rdg + 5 digits)	1nF	
51.2µF		10nF	
100µF	±(5.0% of rdg + 10 digits)	100nF	

Overload protection: 250V DC/250Vrms AC

# 2.2.7 Frequency

Z.Z.i i iequeiii	<i>-</i> y		
Range	Accuracy	Resolution	Sensitivity
5.12Hz	± (0.1% of rdg + 5 digits)	0.001Hz	Sine wave 0.6V $\sim$
51.2Hz		0.01Hz	10V rms
512Hz		0.1Hz	(5.12MHz: 1.5V $\sim$
5.12kHz		1Hz	10V rms)
5.12kHz		10Hz	If input voltage
512kHz		100Hz	over range, need
5.12MHz	ĺ	1kHz	adjust

Overload protection: 250V DC/250Vrms AC

Duty cycle: 0.1%∼99.9%

# 2.2.8 Temperature (NiCr-NiSi sensor)

Range		Accuracy	Resolution
°C.	-20~150℃	± (3°C+ 1digit)	1℃
Ü	150~1000 <b>℃</b>	± ( 3% of rdg + 2digits )	' '

Overload protection: 250V DC/250Vrms AC

2.2.9 Diode and Audible continuity test

Range	Description	Test Condition			
<b>+</b>	Display read approximately forward voltage of diode	Forward DC current approx. 0.4mA Reversed DC voltage approx. 1.5V			
-1))	Built-in buzzer sounds if resistance is less than 100Ω	Open circuit voltage approx. 0.5V			

Overload protection: 250V DC or AC rms

#### 3. MEASURING INSTRUCTION

# 3.1 DC & AC Voltage measurement

- 1) Connect the black test lead to "COM" socket and red test lead to the "VΩHz"
- 2) Set the selector switch to desired "V~" position, it shows symbol for testing DC voltage, if you want to test AC voltage, push "SELECT" button switch.
- 3) Connect test leads across the source or load under measurement.
  4) You can get reading from LCD. The polarity of the red lead connection will be indicated along with the DC voltage value.

#### 3.2 DC Current Measurement

- 1) Set the selector switch to desired "200A--- "or "1000A---" position.
- 2) Press the "REL" the display show "0".

Note: As the jaw core may remain some magnetic force after using for a while. If the display can not reach "0" When press the "REL", please take following process to correct it:

- A. To change the direction of the measured DC current.
- B. Open the JAWS several times.
- 3) Open the clamp by pressing the jaw-opening handle and insert the cable (one cable only) to be measured into the jaw.
- 4) Close the clamp and get the reading from the LCD panel.

Note: Before this measurement, disconnect the test lead with the meter for safety. Non unit sign display of DCA.

# 3.3 AC Current measurement

- 1) Set selector switch to desired "400/1000A~" position.
- 2) Open the clamp by pressing the jaw-opening handle and insert the cable (one cable only) to be measured into the jaw.
- 3) Close the clamp and get the reading from the LCD panel.

#### Note:

- a) Before this measurement, disconnect the test lead with the meter for safety.
- b) In same occasion that the reading is hard to read, push the D.HOLD button and read the result later.

#### 3.4 Resistance measurement

- 1) Connect the black test lead to "COM" socket and red test lead to the "VΩHz"
- 2) Set the selector switch to desired " $\Omega$ " position, the present function is resistance measurement, if it is other function, push the SELECT to select resistance measurement.
- 3) Connect the probes across circuit to be tested.
- 4) Read the result from the LCD panel.

Caution: Ensure that the circuit to be tested is "dead".

Max. input over-load: 250V rms < 10sec

# 3.5 Capacitance measurement

- 1) Connect the black test lead to "COM" socket and red test lead to the "VΩHz" socket.
- 2) Set the selector switch to desired " $\Omega \rightarrow 0$ "  $\rightarrow 1$ " position, push "SELECT" to choose Capacitance measurement.
- 3) Connect the probes to the capacitance to be tested.
- 4) Read the result from the LCD panel.

- a) Capacitors should be discharged before being tested.
- b) This device adopts charging mode to measure capacitance, so when testing large capacitance, it will take longer time before the final indication, and the larger capacitor, the longer the time (For 100uF range, it will take about 15 seconds).
- c) When testing small capacitance, to assure the measurement accuracy, first press "REL", then go on measuring.

Max. input over-load: 250V rms < 10sec

### 3.6 Frequency measurement

- 1) Connect the black test lead to "COM" socket and red test lead to the " $V\Omega Hz$ " socket.
- 2) Set the selector switch to desired "Hz" position.
- 3) Connect the probes to the point of measurement and read the frequency from the display.

Max. input over-load: 250V rms < 10sec

# 3.7 Temperature measurement

- 1) Connect the black test lead of the sensor to "T-" socket and the red test lead to the "T+" socket.
- 2) Set the selector switch to "oc" position.
- 3) Put the sensor probe into the temperature field under measurement.
- 4) Read the result from the LCD panel.

Max. input over-load: 250V rms < 10sec

- A. The temperature function shows the random number at ordinary times. must insert the thermocouple in temperature test hole while examining
- B. This meter in closure WRNM-010 type contact thermocouple limit temperature is 250 °C (300 °C shortly ).
- Please don't change the thermocouple at will, otherwise we can't quarantee to measure accuracy.
- Please don't importing the voltage in the temperature function.

# 3.8 Diode & Audible continuity Testing

- 1) Connect the black test lead to "COM" socket and red test lead to the "VΩHz" socket.
- 2) Set the rotary switch at the " $\Omega \rightarrow -$ " range position, push "SELECT" to choose Diode or Audible continuity measurement.
- 3) On diode range, connect the test leads across the diode under measurement, display shows the approx. forward voltage of this diode.
- 4) On Audible continuity range, connect the test leads to two point of circuit, if the resistance is lower than approx.  $100\Omega$ , the buzzer sounds.

NOTE: Make sure the power is cut off and all capacitors need to be discharged under this measurement.

Max. input over-load: 250V rms < 10sec

# 3.9 Connect to mobile phone APP

The meter has serial data output function. It can be connected with mobile phone by Bluetooth, so the measured data can be recorded, analyzed, and processed by mobile phone APP. Before use this function, you need install the mobile phone APP by scan the QR code.

# ⚠ NOTE: The mobile phone APP can be installed in iphone 4S iOS or android 4.30 system and up.

- 1) Make sure the "CLAMP METER" mobile phone APP successfully installed before any measurement.
- 2) Open the Bluetooth of the mobile phone, Run the "CLAMP METER" mobile phone APP to enter the main interface.
- 3) Turn on the meter, the meter will connect to mobile phone automatically, when the "Start" key change to green, click the "Start" key to measure and view the synchronic data or graph in the mobile phone APP.
- 4) The MAX or MIN value and corresponding time will display on the mobile phone APP, and the average value in a period of time from start measurement will display too.
- 5) Press the "Reset" key to reset measurement, the old data will be cleared and resume data recording. Press the "Stop" key to stop connection.
- 6) Press the "Data" key to view the data and time, Press the "Graph" key to view the graph, Press the "Save" key to save the data or the graph. Press the "Home" key to return the main interface.
- 7) More information about the mobile phone APP, please refer to the Help topic including in the APP.

# 4. CARE AND MAINTENANCE

### **4.1 CARING FOR YOUR MULTIMETER**

Your Digital Multi meter is an example of superior design and craftsmanship. The following suggestions will help you care for the multi meter so you can enjoy it for years.

- 1) Keep the multi meter dry. If it gets wet, wipe it dry immediately. Liquids can contain minerals that can corrode electronic circuits.
- 2) Use and store the multi meter only in normal temperature environments. Temperature extremes can shorten the life of electronic devices, damage batteries and distort or melt plastic parts.
- 3) Handle the multi meter gently and carefully. Dropping it can damage the circuit boards and cause and can accuse the multi meter to work improperly.
- 4) When take current measurement, keep the cable at the center of the clamp will get more accurate test result.
- 5) Keep the multi meter away from dust and dirt, which can cause premature wear of parts.
- 6) Wipe the multi meter with a damp cloth occasionally to keep it looking new. Do not use harsh chemicals, cleaning solvents, or strong detergents to clean
- 7) Use only fresh batteries of the required size and type. Always remove old or weak batteries. They can leak chemicals that destroy electronic circuits.
- 8) Please take out the battery when not using for a long time.

# 4.2 9Volt battery replacement

- 1) Ensure the instrument is not connected to any external circuit. Set the selector switch to "OFF" position and remove the test leads from the terminals.
- 2) Open the cover of the battery cabinet by a screwdriver.
- 3) Replace the old batteries with the same type batteries.
- 4) Close the battery cabinet cover and fasten the screw.

Above picture and content just for your reference. Please be subject to the actual products if anything different or updated. Please pardon for not informing in advance.